

**Final Operational/Workover Report
Well Workover
Para et al Cameron C-74
Well ID # 1939
UWI: 300C746010117153**

On February 27, 2007 Paramount Resources Ltd. moved Concord Well Servicing rig # 19 onto Para et al Cameron C-74 to perform a workover operation to determine the cause of a tubing leak and make repairs to correct the problem. Service rig operations were completed on February 28, 2007. A chronological summary of the operations follows.

27/2/2007: Moved service rig onto location and rigged up service rig and ancillary equipment.

28/2/2007: Bled off casing pressure. Attempted to stroke bottom hole pump with rig. Pump seized. Jarred down on tubing. Pressure tested tubing to 7 MPa. Unseated pump. Pumped 4 m³ KCl water down tubing. Pulled out of hole with rod string, recovering BHP. Surface tested new BHP. Attempted to run BHP into hole. Pump hanging up at surface. Pumped 3 m³ solvent down tubing. Ran in hole with new BHP on original rod string. Pumped 2.5 m³ solvent down tubing. Seated BHP. Pressure tested tubing to 7 MPa. Re-hung horses head. Attached bridle to rod string. Stroke tested BHP. Rigged out service rig and ancillary equipment.