






MP 2300 Chromat

V
I
S

S
H
O
W

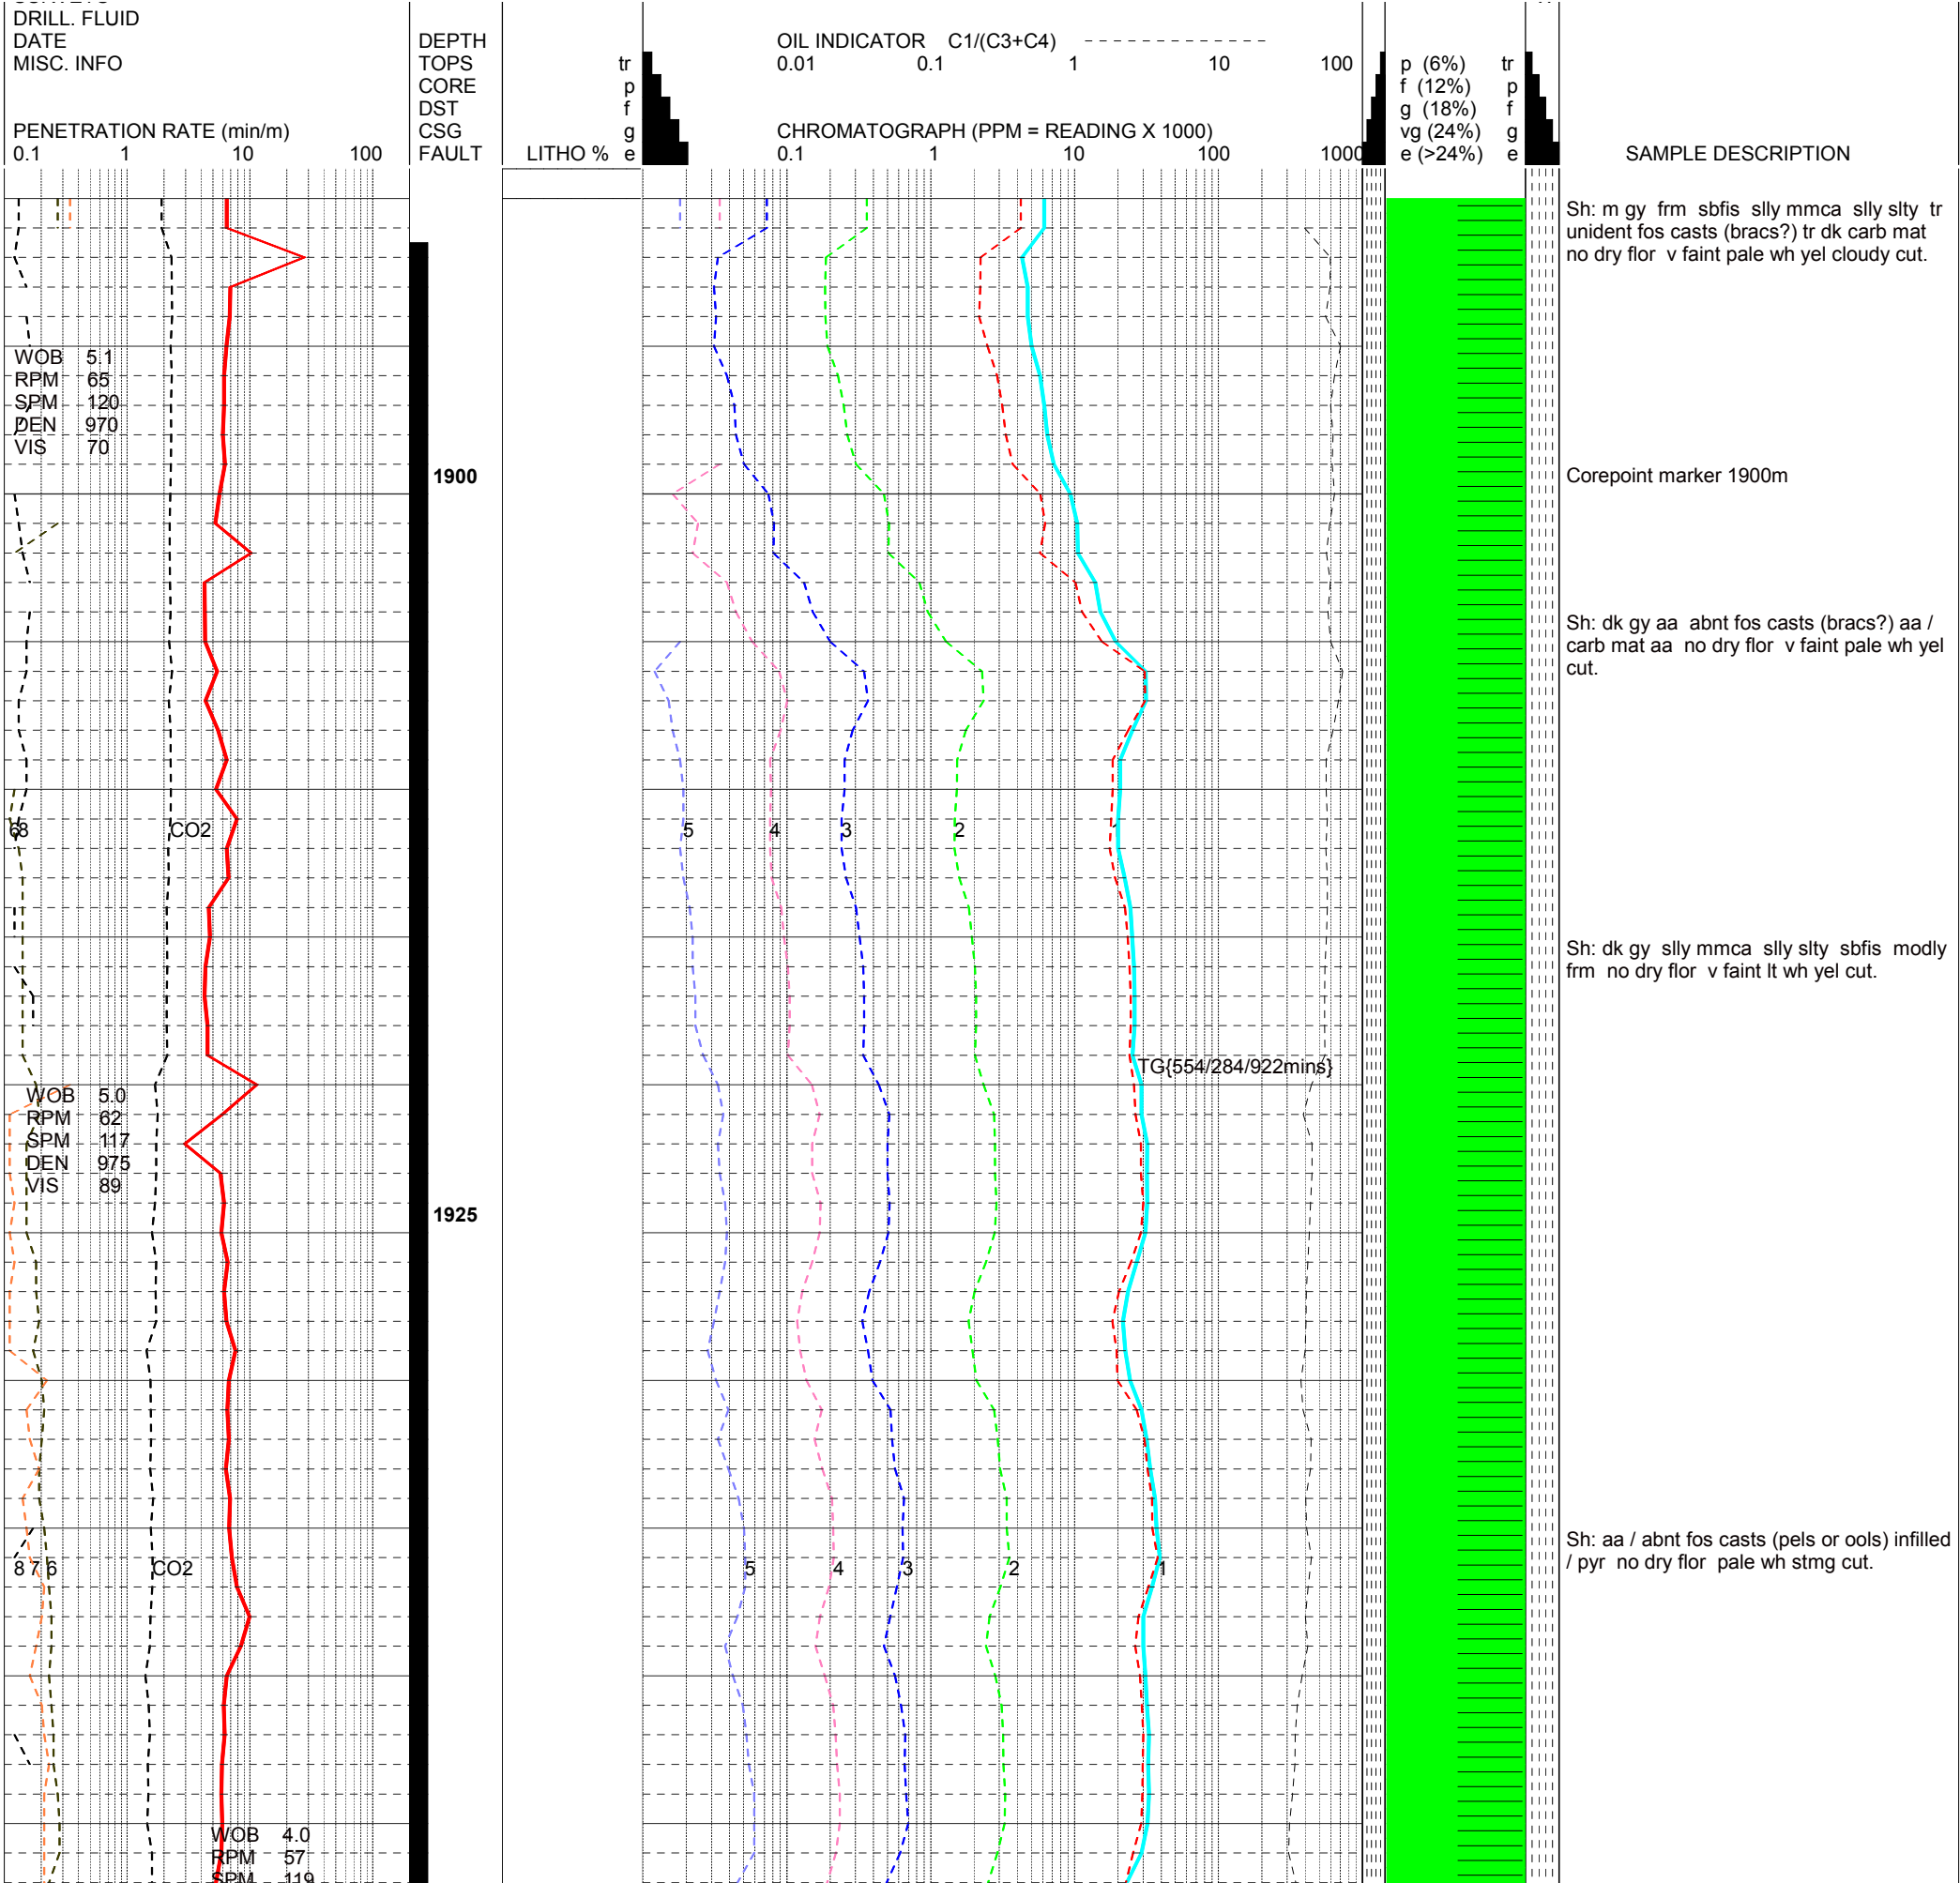

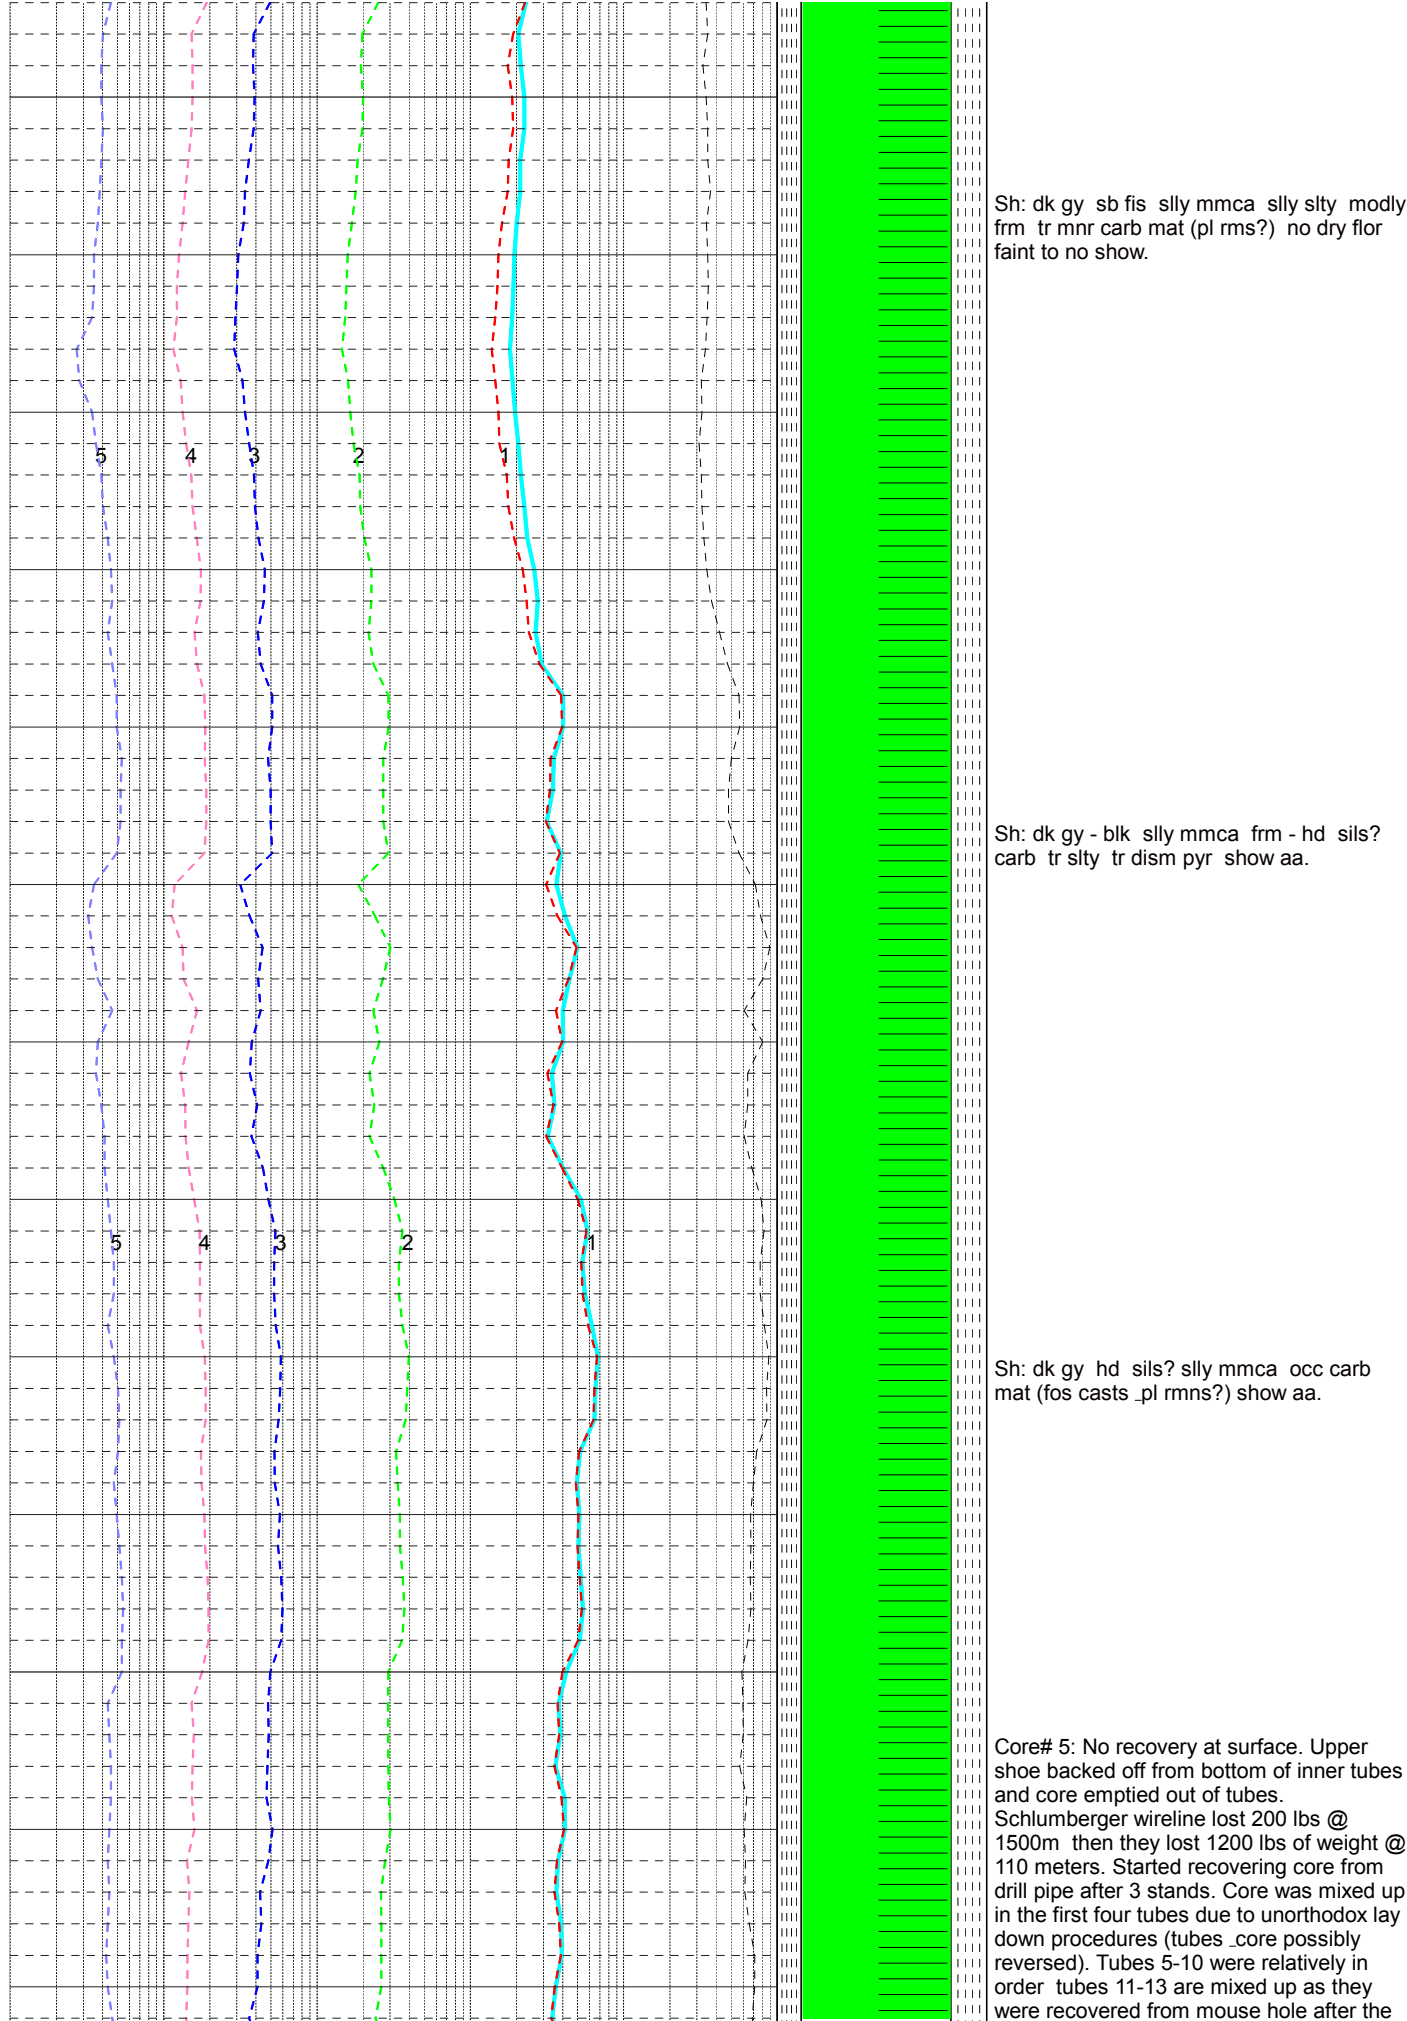
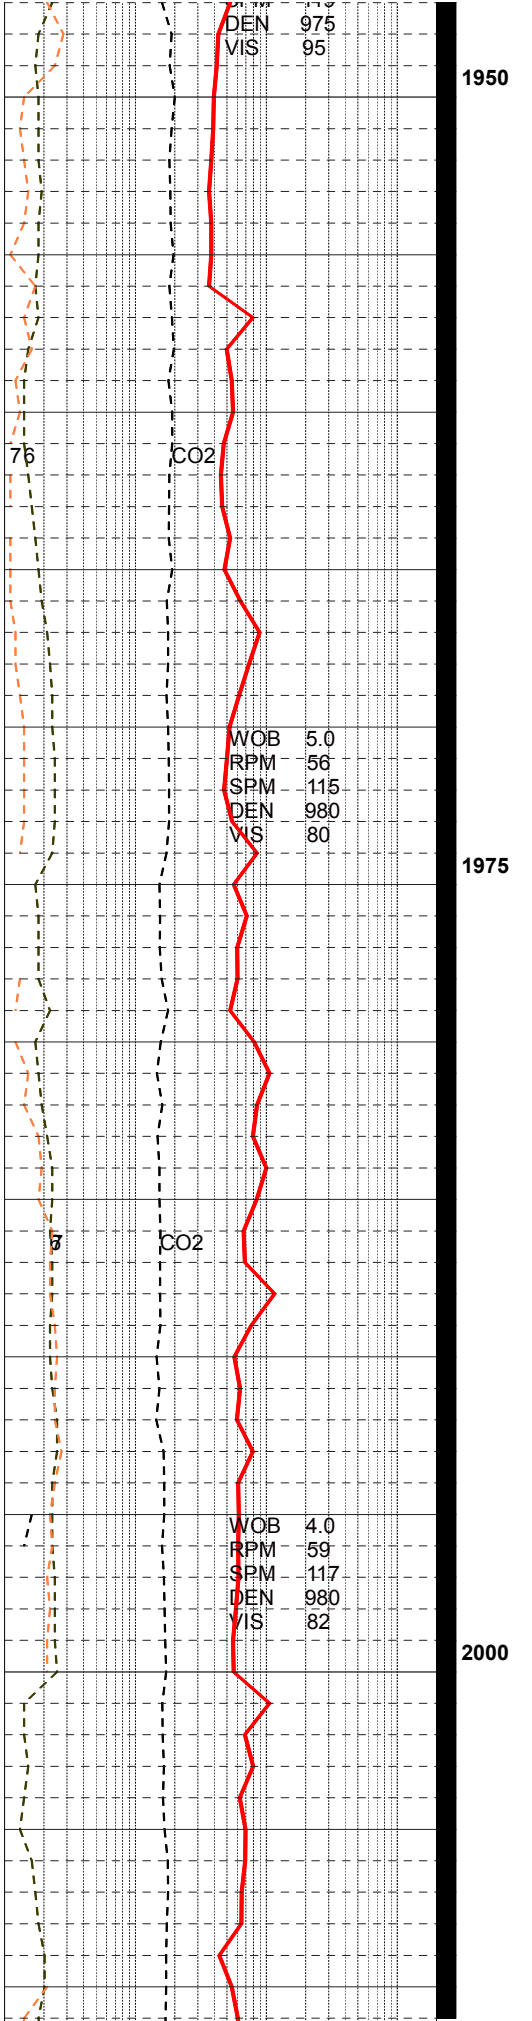


Sh: dk gy sb fis sily mmca sly slty modly
frm tr mnr carb mat (pl rms?) no dry flr
faint to no show.

Sh: dk gy - blk sily mmca frm - hd sils?
carb tr slty tr dism pyr show aa.

Sh: dk gy hd sils? sly mmca occ carb
mat (fos casts pl rmns?) show aa.

Core# 5: No recovery at surface. Upper
shoe backed off from bottom of inner tubes
and core emptied out of tubes.
Schlumberger wireline lost 200 lbs @
1500m then they lost 1200 lbs of weight @
110 meters. Started recovering core from
drill pipe after 3 stands. Core was mixed up
in the first four tubes due to unorthodox lay
down procedures (tubes core possibly
reversed). Tubes 5-10 were relatively in
order tubes 11-13 are mixed up as they
were recovered from mouse hole after the

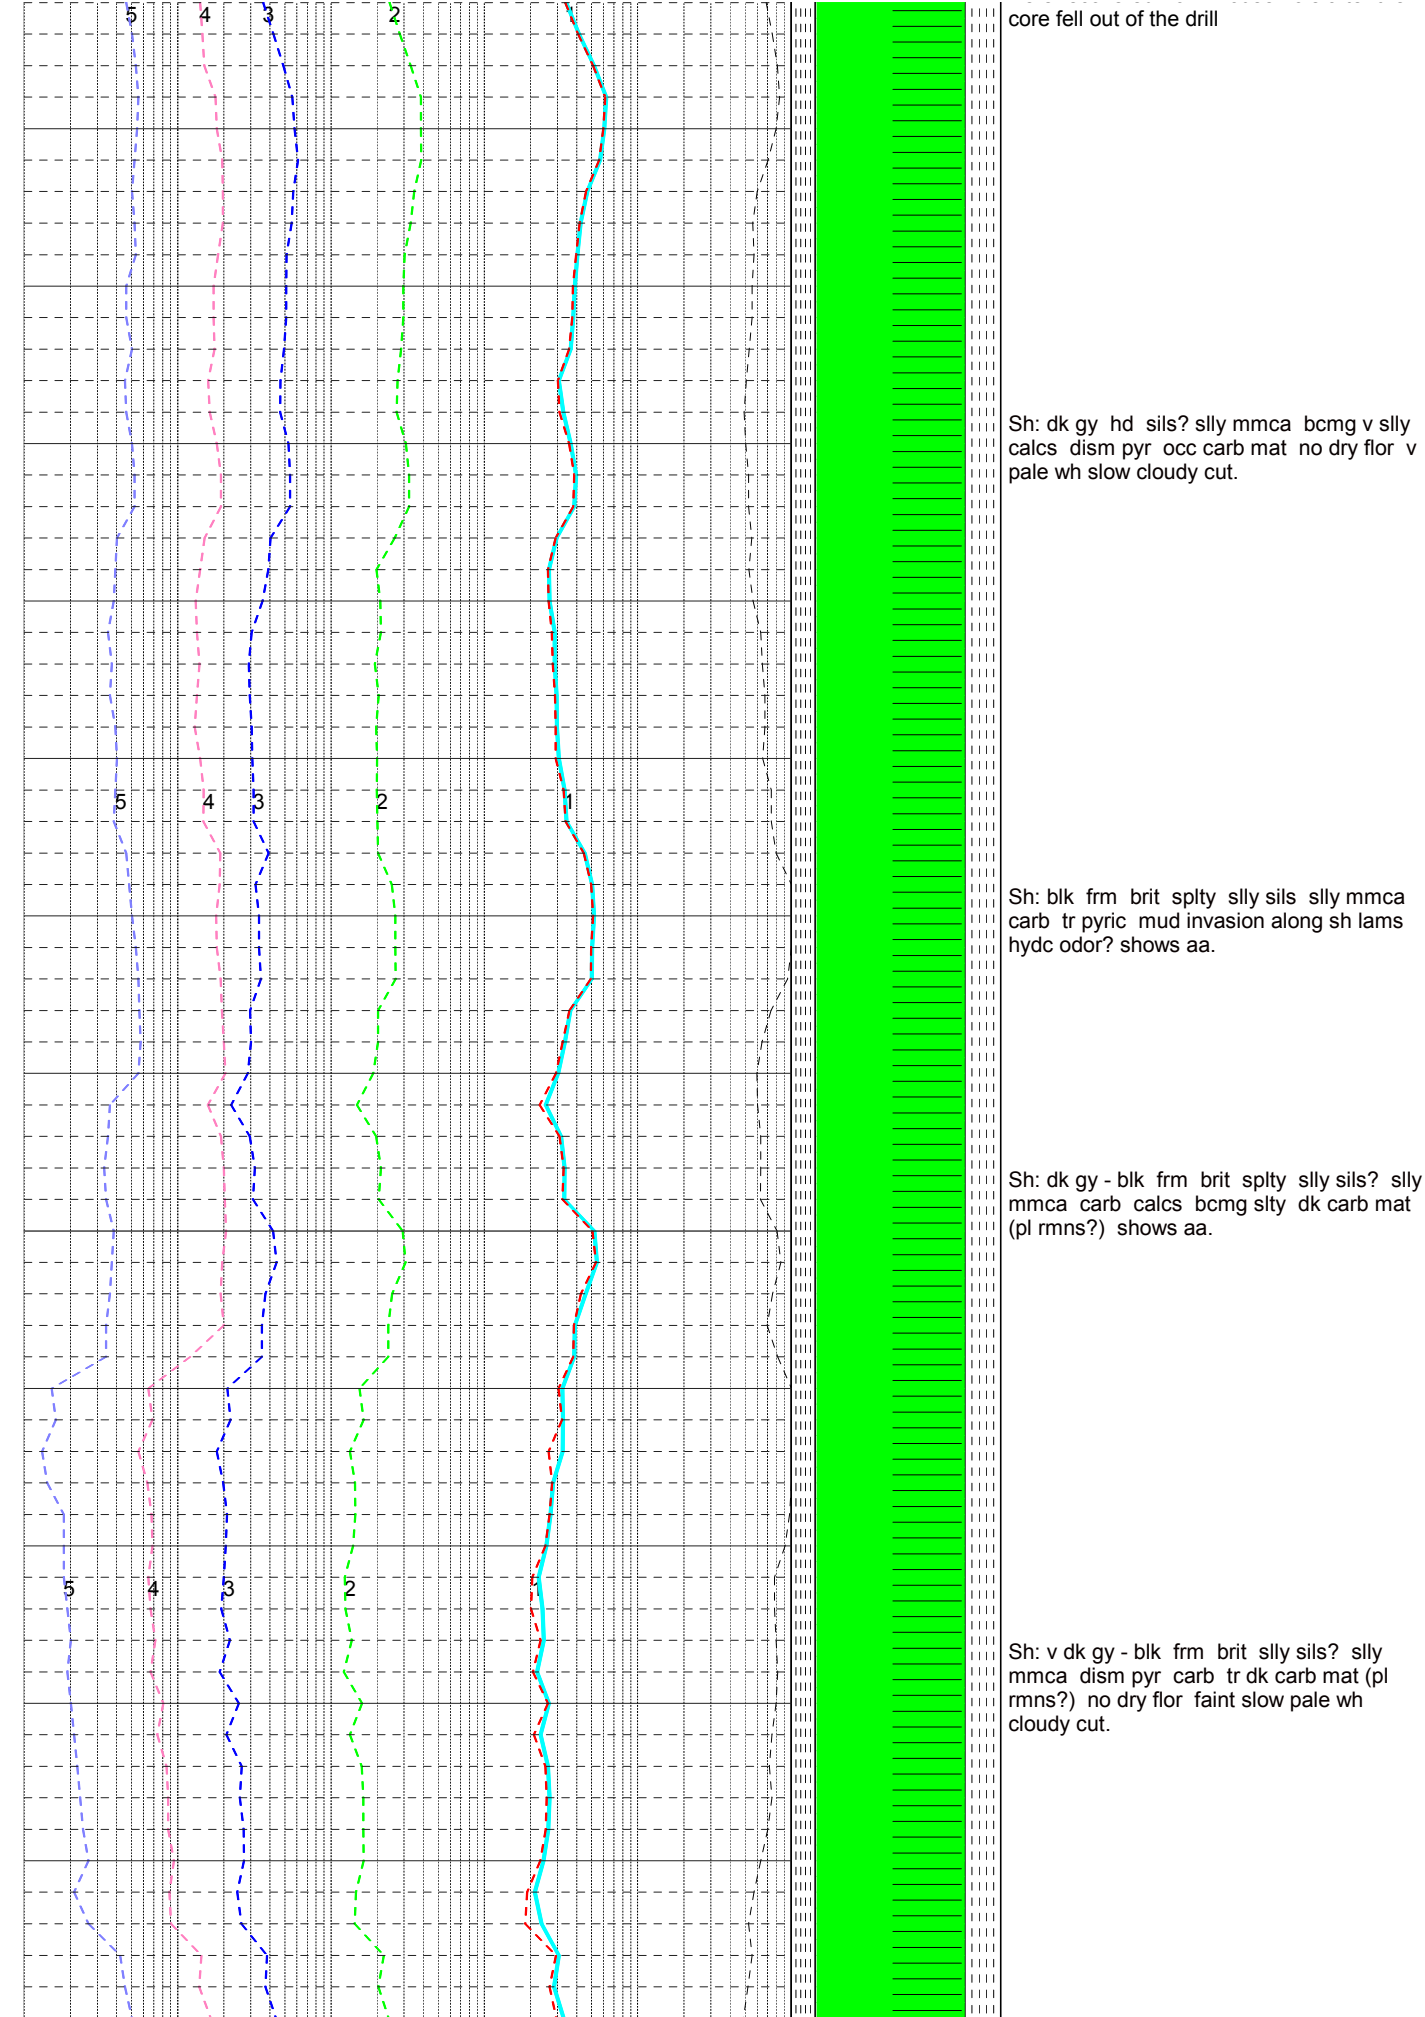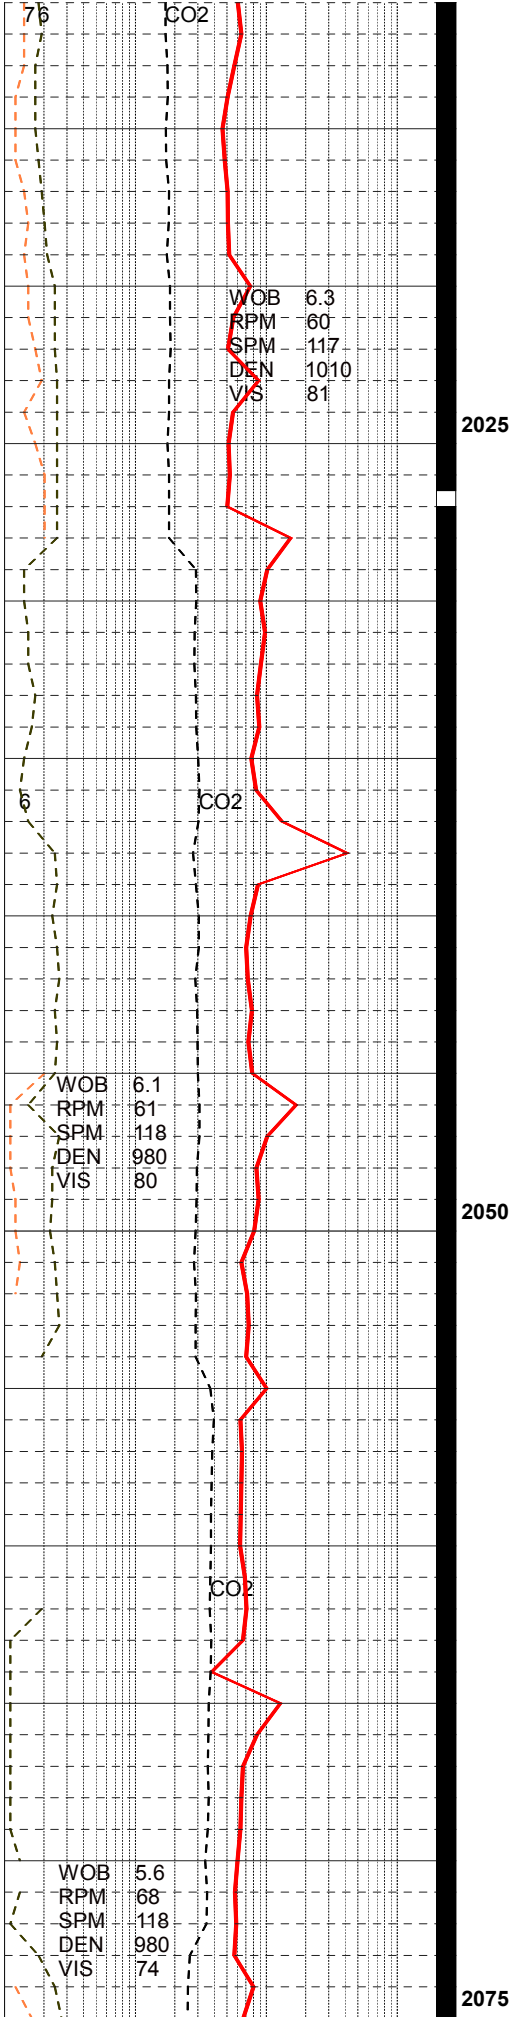




core fell out of the dri

Sh: dk gy hd sils? slly mmca bcmg v slly
calcs dism pyr occ carb mat no dry flor v
pale wh slow cloudy cut.

Sh: blk frm brit splty sllly sils sllly mmca
carb tr pyric mud invasion along sh lams
hydc odor? shows aa.

Sh: dk gy - blk frm brit splty sly sils? sly
mmca carb calcs bcmg sly dk carb mat
(pl rmns?) shows aa.


Sh: v dk gy - blk frm brit slly sils? slly
mmca dism pyr carb tr dk carb mat (pl
rmns?) no dry flor faint slow pale wh
cloudy cut.

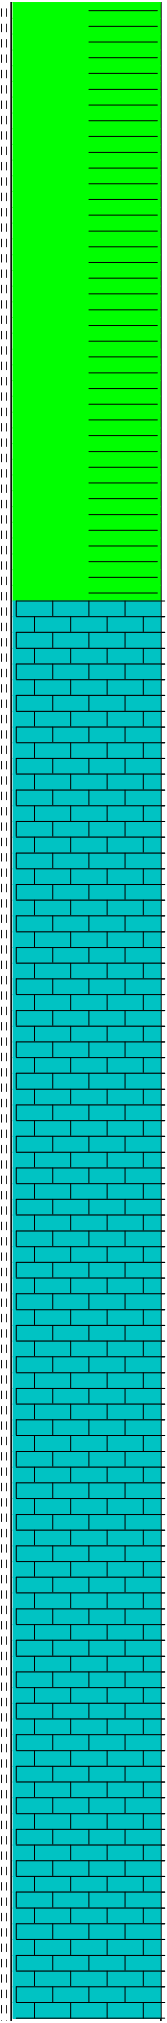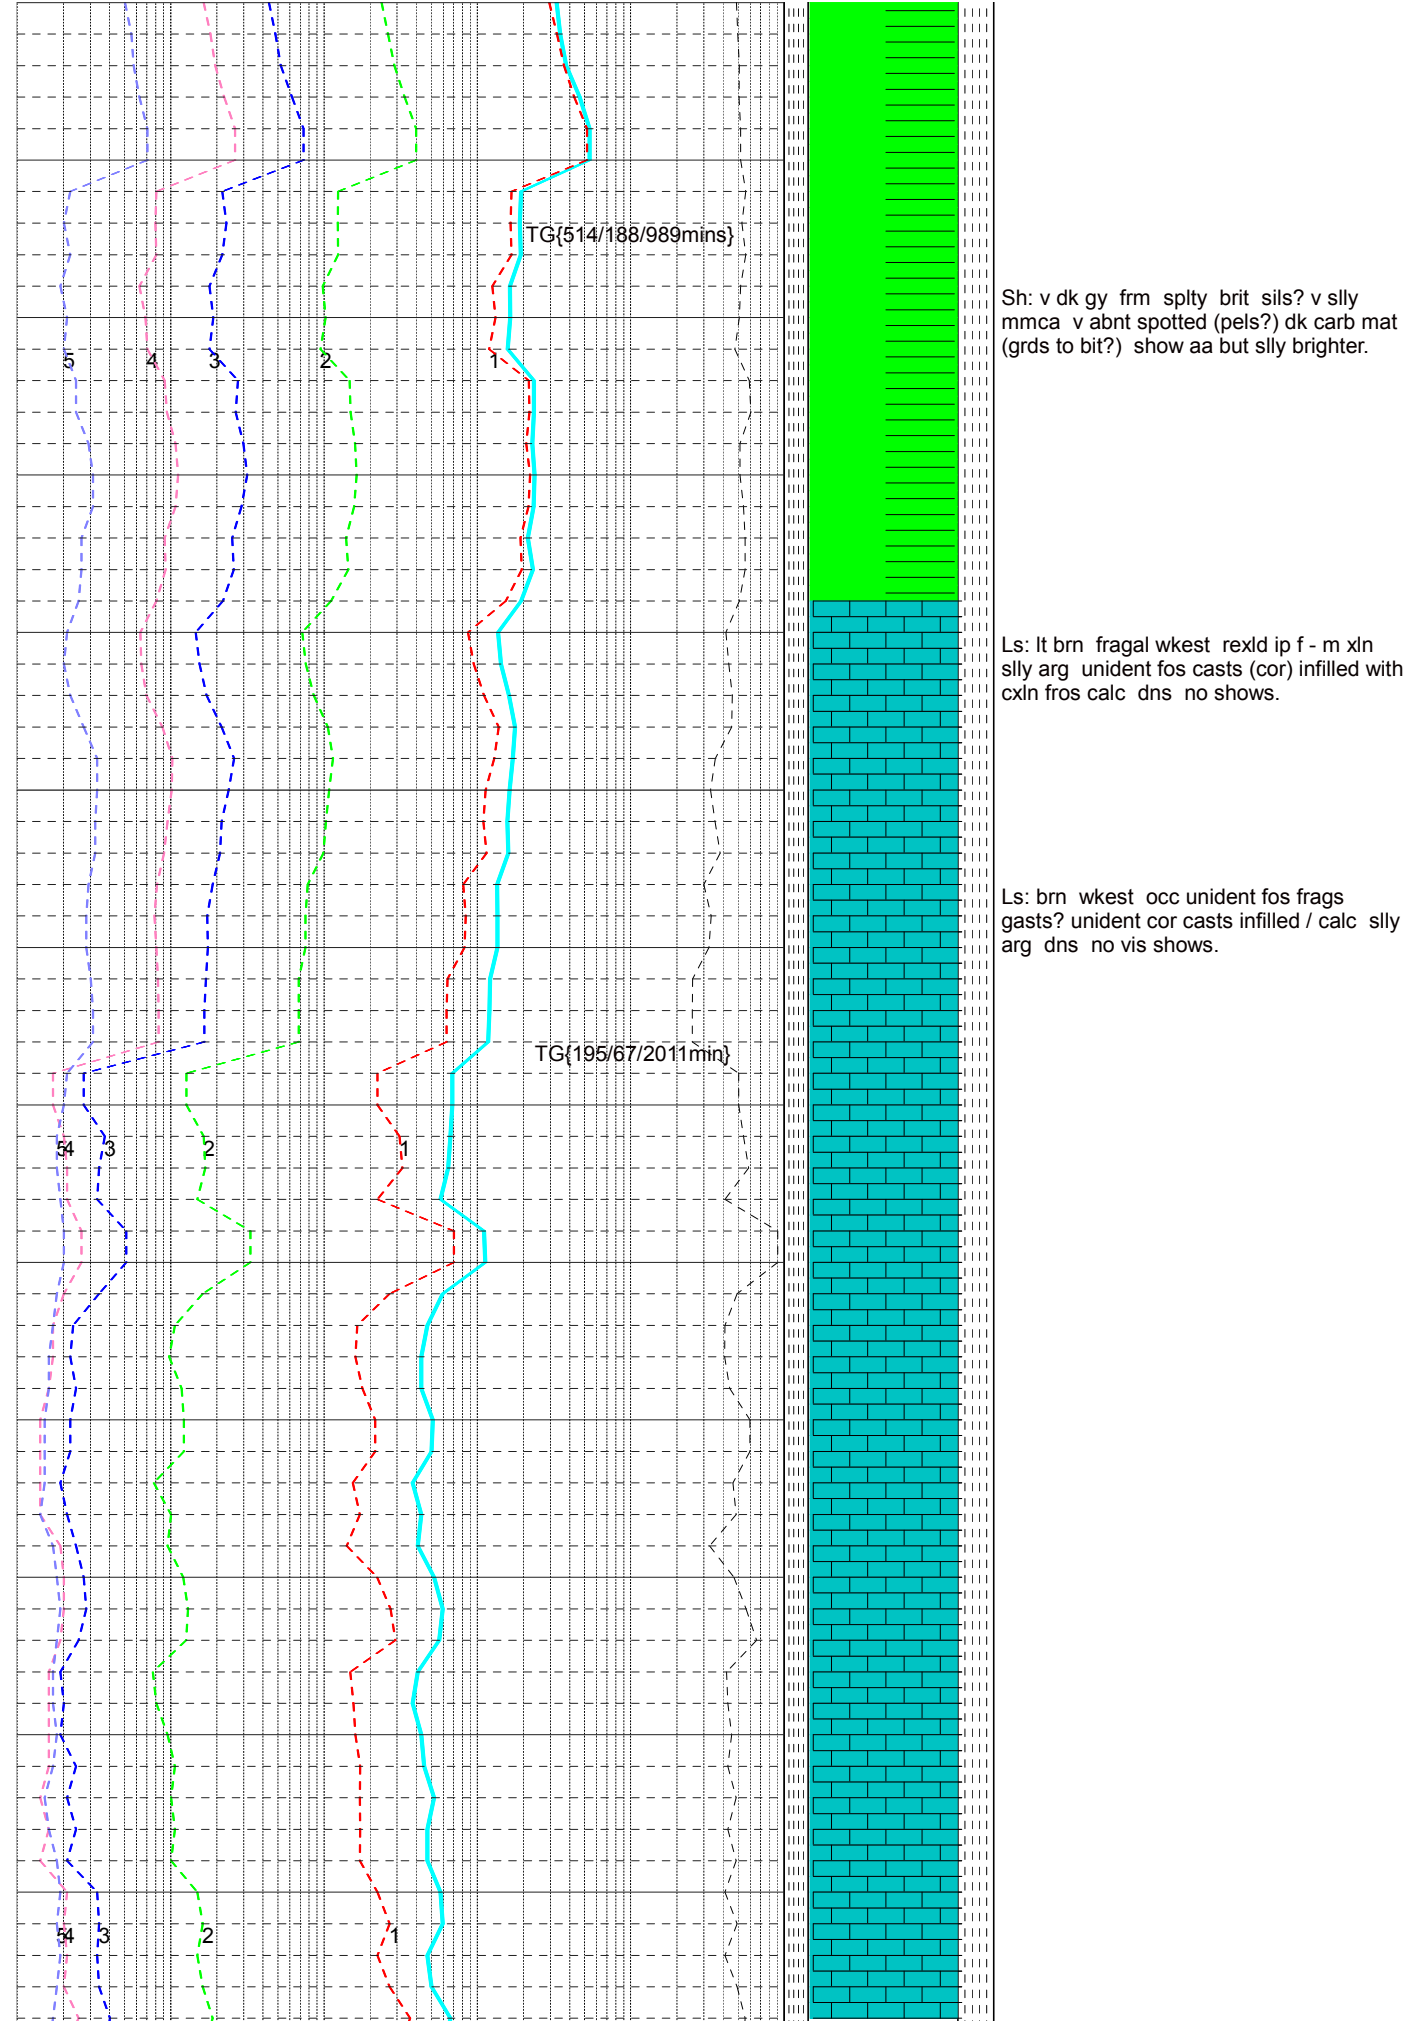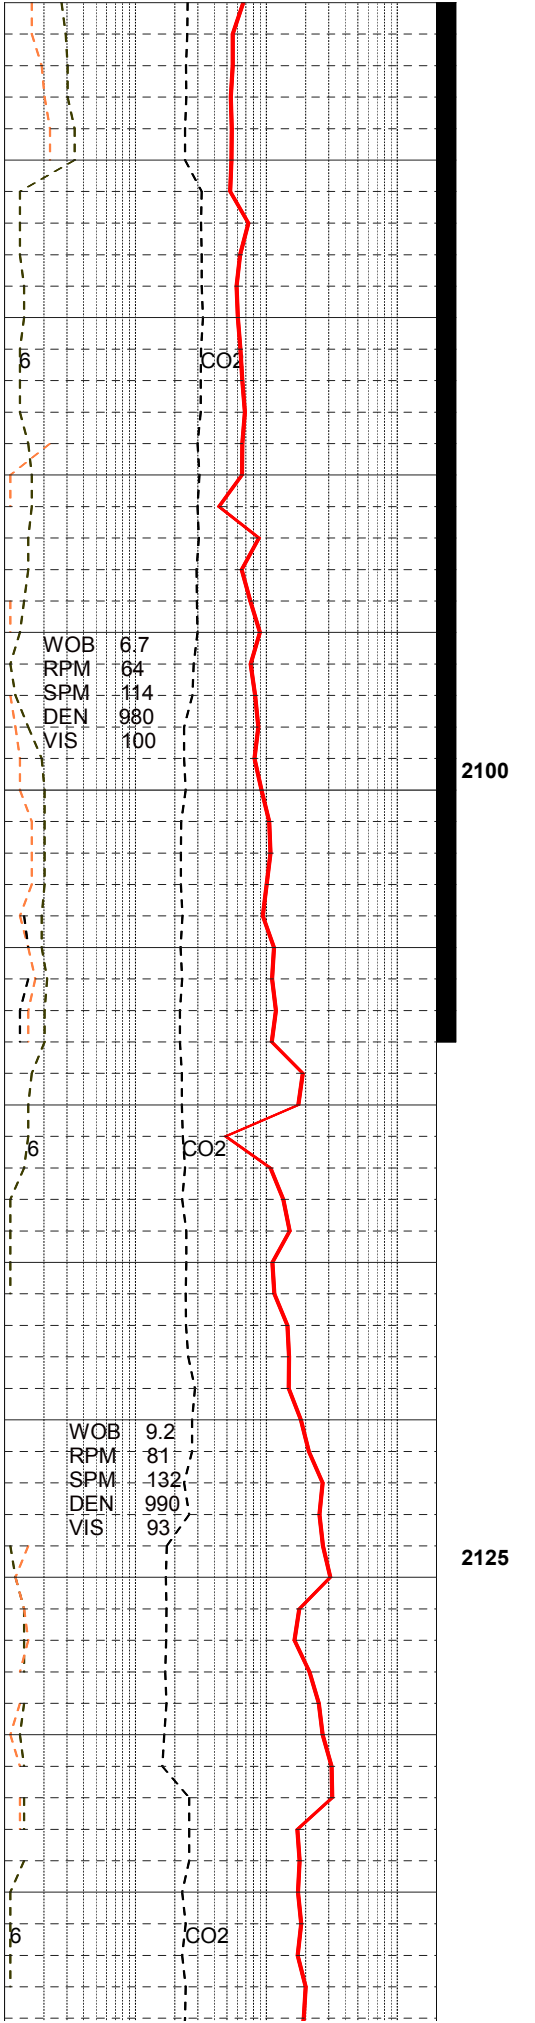

Sh: v dk gy frm splty brit sils? v sllly
mmca v abnt spotted (pels?) dk carb mat
(grds to bit?) show aa but sllly brighter.

Ls: lt brn fragal wkest rexld ip f - m xln
sllly arg unident fos casts (cor) infilled with
cxln fros calc dns no shows.

Ls: brn wkest occ unident fos frags
gasts? unident cor casts infilled / calc sllly
arg dns no vis shows.

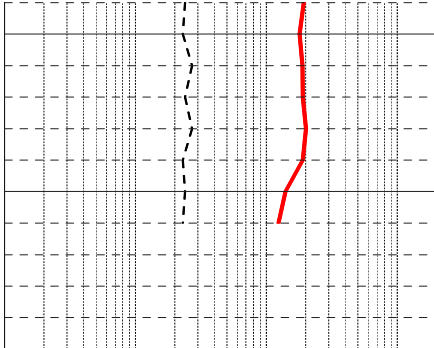

2150

